SUBJECT

Fuel Gauge Stays Empty after Refueling / Fuel Gauge Erratic

MODEL Z3 roadster/coupe, M roadster/coupe (E36/7). Vehicles produced before December 15, 2000

SITUATION The customer complains that after refueling the fuel gauge stays on empty, or the operation of

the fuel gauge is erratic.

For Z3 from 9/98, and M roadster/coupe, FC 2 (Fuel sensor voltage plausibility) will be set in the

Instrument Cluster.

CAUSE The formation of a non-conducting deposit on the conductor surface of the fuel level sensor

CORRECTION On a customer complaint basis only remove and replace the fuel level sensor with "Gold

system" sensor (refer to repair instructions 16 12 000).

PARTS INFORMATION

Part Number Description Quantity

16 14 6 756 323 Fuel pump / level sensor 1

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty.

Defect Code 16 14 93 18 00

Labor Operation: Remove and replace fuel level sensor

Labor Operation Labor Allowance 00 52 342 13 FRU +00 52 961 11 FRU

Note:

The following explanations will spell out the correct use of the work times.

Main Work:

Use this labor operation number when the only

repair performed is the listed warranty repair.

OR

+Associated Work: Use this labor operation number when other repairs or

services are performed along with the listed warranty repair.

Under no circumstances should both labor operation

numbers be claimed. Attempts to claim both times will result in an unnecessary delay in claim processing and payment.